PI TAPE®

PI TAPE® BRAND DIGITAL TAPE 108"- 120" Outside Diameter

U.S. Patent No. 9,829,298

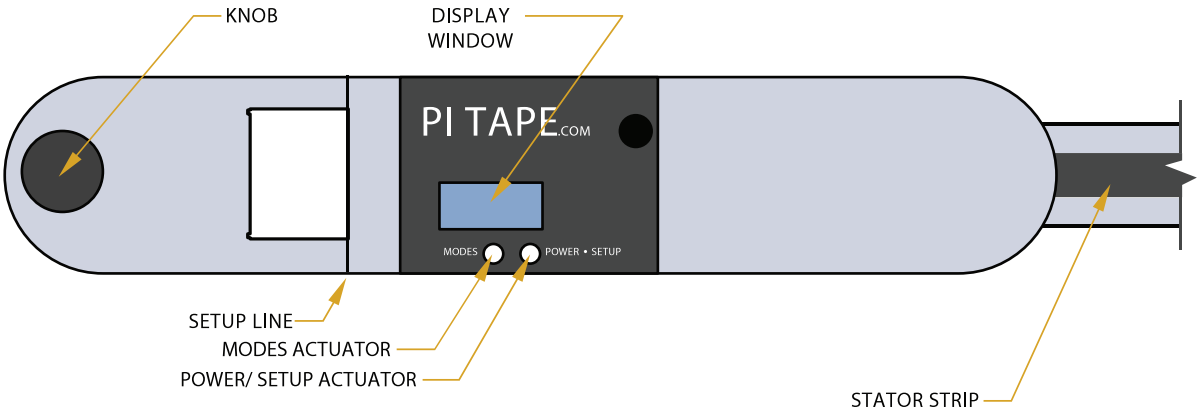

Instructions for 108" – 120" (programmed at **120**"):

1) Insert tail of tape through window at the head of tape, then slide tail underneath digital unit to prepare for setting up lines (listed on step 3 below).

   NOTE: Use care when sliding stator strip underneath digital unit.

2) Turn on digital unit by pushing right button until dashes are displayed.

3) Position tape so that the set-up line on the head of the tape lines up exactly with the 120" set-up line on the tail of the tape.

4) Push right button until "SET" is displayed. Digital unit should now display the measurement that corresponds with the set-up line.

5) Take readings while applying 5 lbs. tension. Left button is multifunctional; pressing it repeatedly will display the different measurement modes. The measurement modes offered are as follows: metric circumference; metric diameter, inch circumference; inch diameter.

6) Digital unit turns off automatically after approximately 5 minutes.

   NOTE: If digital unit needs to be reset or error message is shown, turn off digital unit by pressing right button until all characters disappear. Then repeat steps 2 through 4.

   New Tape Tolerance: ± .005"

   ADVISORY: Should any repairs be needed, please contact us. Opening the housing unit may result in voiding the manufacturer's warranty. For battery replacement, please see the Digital Battery Change Instruction Sheet.

   CARE: Keep tape clean and dry. Keep tape in a flat & straight position when not in use.

PI TAPE and the logo are trademarks of Pi Tape Texas, LLC, and they are registered in the USA and in 45 other countries.
Please visit https://www.pitape.com/trademarks.htm for a list of countries in which our trademarks are registered.

© Copyright 2019 Pi Tape Texas LLC. All rights reserved. https://pitape.com