



## TO READ GO/NO-GO DIAMETER TAPES

Standard style for tapes with a starting point of UNDER 12" (300mm).

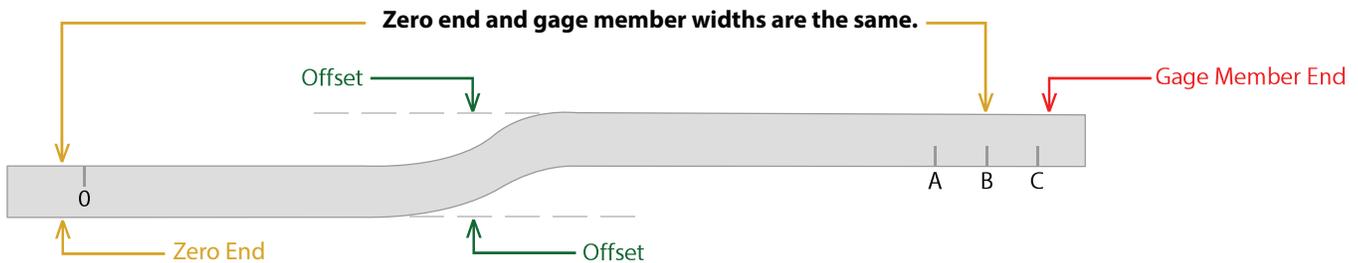

Standard style for tapes with a starting point of 12" (300mm) and OVER.

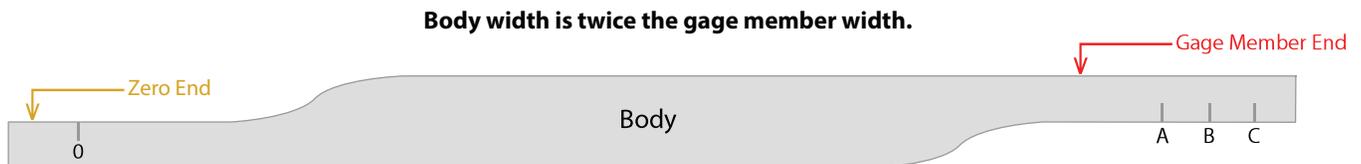

A = minus tolerance  
 B = nominal dimensions  
 C = plus tolerance

### EXAMPLE

Make certain the tape and object to be measured are both clean.

Wrap the tape around the object to be measured. Tighten the tape around the object with 5 pounds (2.25 kg) tension for O.D. tapes.

For inside diameter tape, place the tape inside the object to be measured. Inside diameter tapes are manufactured at 68° F under zero tension. All inside diameter tapes are marked I.D. and are calibrated for direct inside diameter readings.

Tape may have one or more sets of separate A B C dimensions on one tape. Anytime "0" line falls between A B C lines, part is within tolerance.

As a suggestion for checking very large diameters – pieces of masking tape can be used to hold the tape in the proper parallel position.

### Care

Tape is delicate, handle with care.

When not in use, wipe clean and apply a light rust preventive oil\*. Store in tape container.  
 \* White Easy to Read Tape - Do not oil or use solvents to clean this product.

No periodic adjustments are needed.

Make sure the tape has not been stepped on or kinked, which may destroy the accuracy.