


TO READ INSIDE DIAMETER INCH TAPE

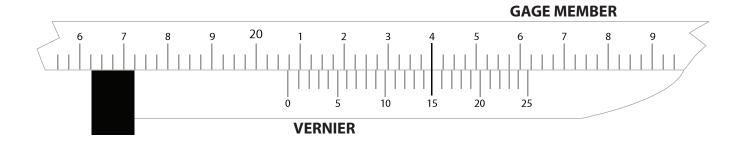

Vernier Scale divides each graduation on Gage Member into 25 parts or .001 of an inch

EXAMPLE

Make certain the tape and object to be measured are both clean.

Each line on the gage member represents .025" of diameter, while each line on the vernier represents .001".

Place the tape inside the object to be measured. The vernier scale should be just below the gage member. Make certain the tape is aligned on the inside diameter flat and snug to the part, straight and parallel so the gage member is flat against the vernier scale.

Locate the "zero" on the vernier scale and note the highest value achieved on the gage member above it (the highest value to the left of the zero). In this example, the value is 20.050".

Next, observe the vernier scale's value at the point where it lines up exactly with a marked division line on the gage member. In this example, the value is 15 (.015").

Finally, to obtain the diameter of the object, simply add the two values together: 20.050" + .015" = 20.065"

Inside diameter tapes are manufactured at 68°F under no tension. All inside diameter tapes are marked I.D. and are calibrated for direct inside diameter readings.

As a suggestion for checking very large diameters – pieces of masking tape can be used to hold the tape in the proper parallel position.

Tape resolution 0.001"

Care

Tape is delicate, handle with care. Keep tape clean and dry.

After each use, wipe clean and apply a light rust preventive oil*. Store in tape container and in a low moisture environment. * White Easy to Read tapes Stainless or 1095 Spring Steel - Do not oil or use solvents to clean this product.

White Easy to Read 1095 Spring Steel must be stored in a low moisture environment to prevent rust.

No periodic adjustments are needed.

Make sure the tape has not been stepped on or kinked, which may destroy the tape tolerance.

PITAPE and the Good are trademarks of PiTape Texas, LLC, and they are registered in the USA and in 45 other countries. Please visit https://www.pitape.com/trademarks.htm for a list of countries in which our trademarks are registered.